



RENAULT CONFIDENTIAL

CLIO IV

LOGAN II

SANDERO II

Type

Fabrication cut-offs

BHMG	R020533	to	R161629
B8MG	A000373	to	A131233
B8MP	A000572	to	A068574
K8MG	A094689	to	A100013
K8MP	A097265	to	A098176
L8MG	A002268	to	A128353
L8MP	A117999	to	A117999

Fitted with Landi Renzo LPG system

Cancels and replaces Technical Note No. 4990C dated AUGUST 2013.

Modifications: Addition of OTS 0BRB

17C

REPROGRAMMING THE LPG COMPUTER

OTS: 0BQF MARK: L3
0BRB

Other sub-section concerned:

999

• Engine: **D4F**

Basic manual:

Actis solution: **9769, 9780, 9781**

The vehicle fabrication cut-offs are given as examples only.
IMPORTANT: before starting any operation, check that the vehicle is affected by 0BQF or 0BRB.

• **Countries with PGCS**

Network with ICM:	Refer to the "List of OTS operations to be carried out" in ICM.
Network without ICM:	On the blue label, check the box: L3. • If the box is not marked with a cross, • and if the vehicle is included in the table above, you should contact your primary network to consult the "List of OTS to be carried out" in ICM.

• **Countries without PGCS**

All networks:	On the blue label, check the box: L3. • If the box is not marked with a cross, • and if the vehicle is included in the table above, the vehicle is affected.
---------------	--

TECHNICAL DATA

Preventive operation

- Reprogramming the LPG computer.

Objective

- The vehicle does not switch into LPG mode.

Marking the vehicle after work has been carried out

- Affix a blue label to the driver's side front shock absorber turret: **part no.: 49 39 031 089**.
- Mark a cross in box **L3** using a marker pen.

Description of the operation

REPROGRAMMING THE LPG COMPUTER

- For **CLIO IV**, apply the **ACTIS** solution no. **9769**.
- For **LOGAN II SANDERO II EURO 4**, apply the **ACTIS** solution no. **9780**.
- For **LOGAN II SANDERO II EURO 5**, apply the **ACTIS** solution no. **9781**.

Note

Install the file setup_1.0.0.4.exe.

Reprogram the LPG computer using the reprogramming file available as an attachment to the Actis solution corresponding to your vehicle.

Use the reprogramming USB cable, part number **77 11 392 500**.

- Clear all the DTC codes using the CLIP tool (the CLIP tool must be updated from tool DVD version no. 130).

CLAIM COMPLETION AND CODING

When to take action

- When a recall letter has been sent to the customer and/or the first time the vehicle is brought into the workshop.

Tooling required

- **CLIP** with the latest update: from **tool DVD version no. 130**.
- Reprogramming USB cable:
Part number **77 11 392 500**.
- Landi Renzo reprogramming software 1.0.0.4 (to be downloaded from the attachments of the Actis solutions).
- New LPG calibration available in the Actis solutions:
 - **9769** for **Clio IV**.
 - **9780** for **Logan II Sandero II EURO 4**.
 - **9781** for **Logan II Sandero II EURO 5**.

Time required

Code	Description	Time
0095	Application of OTS	0.1
7605	OTS Reprogramming the LPG computer	0.5
TOTAL		0.6

Destination of removed parts

- In accordance with warranty directives.

Accounts procedure

- In accordance with warranty directives.

OTS code: **0BQF / 0BRB** (0 = Zero)

- Closure date: **According to the Manufacturer's instructions.**